

Majestic Manufacturing, Inc.

Majestic Manufacturing, Inc. * PO Box 128
4536 State Route 7, New Waterford, Ohio 44445

Subject: Lap Bar Cylinder Mounting Position

ATTN: OWNER/OPERATOR

This bulletin pertains to the operation of your Majestic unit. This Service Bulletin **must** remain with the owner's manual at **all** times. If you have any questions regarding the Bulletin, contact our office at 330/457-2447, M-F 8:00a.m. -4:30p.m. E.S.T. ** Fax 330/457-7490.

SERVICE BULLETIN

Date: February 19, 1992

S.B. Number: 92-6 Sheet 1 of 2

Notice:

It has been brought to our attention that if the spring cylinder, in the lap bar, is mounted in a reversed position; the lubricating oil inside the cylinder will be drained away from the rod bushing, which could cause premature failure of the cylinder.

All customers with Majestic lap bars installed in their scooter bumper cars are being notified by this service bulletin to reverse their cylinders so that the rod end of the cylinder will be in the position as shown below in Figure 1, or Figure 2 (depending on the style of lap bar installed).

The cylinder can be removed by inserting a screwdriver or knife under the spring clip on the end of the cylinder and prying it up, which will release the cylinder end from the ball stud. After reversing the cylinder, push the spring clip down to secure the cylinder to the ball stud.

If you have any questions on factory standards or procedures on our equipment, contact Majestic Manufacturing, Inc. during normal business hours of 8:00 a.m. to 4:30 p.m. Monday through Friday, E.S.T. at 330/457-2447 or toll free at 1-888-MAJ-RIDE.

Majestic Manufacturing, Inc.

Majestic Manufacturing, Inc. * PO Box 128
4536 State Route 7, New Waterford, Ohio 44445

Subject: Lap Bar Cylinder Mounting Position

ATTN: OWNER/OPERATOR

This bulletin pertains to the operation of your Majestic unit. This Service Bulletin **must** remain with the owner's manual at **all** times. If you have any questions regarding the Bulletin, contact our office at 330/457-2447, M-F 8:00a.m. -4:30p.m. E.S.T. ** Fax 330/457-7490.

SERVICE BULLETIN

Date: February 19, 1992

S.B. Number: 92-6 Sheet 2 of 2

Notice:

Figure 1.

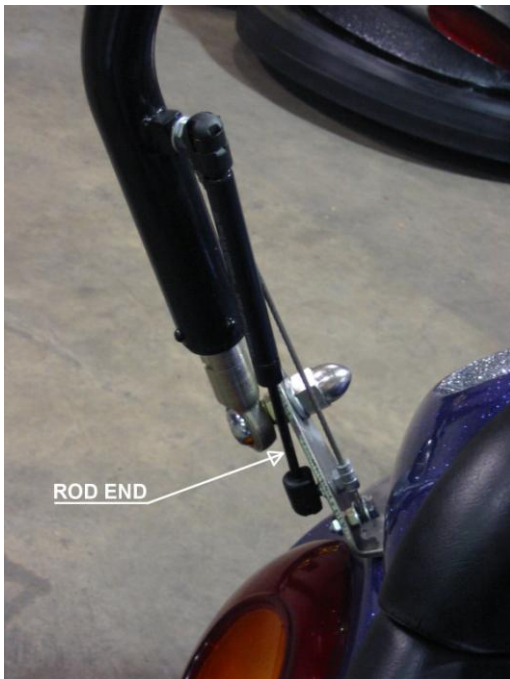


Figure 2.

